



SERVICE PROVIDER

Harbor & Pine Mechanical
Portland, OR
(555) 010-0142

CUSTOMER

Northside Market
Attn: Jane Roe
1820 N Williams Ave, Portland, OR 97227

DATE

Oct 7, 2026

TIME ON SITE

08:40 – 10:15

TECHNICIAN

Chris Doe

APPLIANCE

UNIT	DETAILS
Walk-in cooler	details: Heatcraft condensing unit · S/N T19-44812

TYPE OF SERVICE	REFRIGERANT	
Leak repair	R-404A	
FULL CHARGE	REFRIGERANT ADDED	REFRIGERANT RECOVERED
28 lb	4.5 lb	0 lb
DAYS SINCE THE LAST ADDITION	LEAK RATE (ANNUALIZING METHOD)	
120	48.9 %	

LEAK INSPECTION

INSPECTION METHOD	LEAK FOUND
Electronic detector	Leak found

LEAK LOCATIONS

Flare nut at the TXV inlet.

REPAIR MADE


Re-made flare, replaced nut, pressure tested at 150 psig for 30 min.
--

INITIAL VERIFICATION TEST	FOLLOW-UP VERIFICATION TEST DUE	
Passed	Oct 28, 2026	☒ All visible and accessible components were inspected

TECHNICIAN EPA 608 CERTIFICATION #


Universal 608 · 0712-44890

PHOTOS

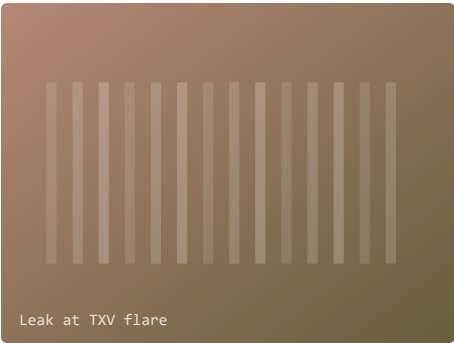

Leak at TXV flare

08:52

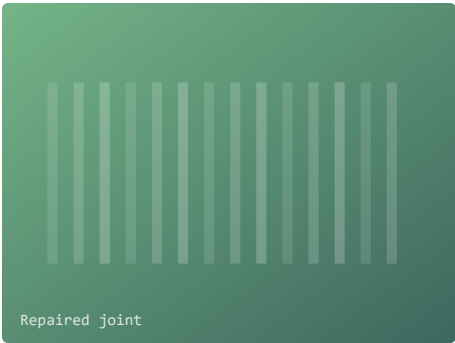

Repaired joint

09:21

TECHNICIAN



Chris Doe · 10:22 AM
EPA 608 Universal



CUSTOMER



Jane Roe · 10:24 AM