



Back Bay Exhaust Cleaning

Commercial kitchen exhaust cleaning ·
Boston · BFD Registered Cleaner

Cleaning and Inspection of Commercial Hood and Ventilation System & Deficiency Report

R-001042

SERVICE PROVIDER

Back Bay Exhaust Cleaning
Boston, MA
(555) 010-0142

CUSTOMER

Harborside Noodle House
Attn: Sam Example
120 Hanover St, Boston, MA 02108

DATE

Oct 7, 2026

TIME ON SITE

08:40 – 10:15

TECHNICIAN

Pat Doe

CLEANING COMPANY AND TECHNICIAN

24-HOUR EMERGENCY SERVICE PHONE

(617) 555-0199

BFD REGISTRATION #

BFD-2026-0417

BFD REGISTRATION EXPIRES

Dec 31, 2026

TECHNICIAN CERTIFICATION #

IKECA CECS 20871

CLEANING SCHEDULE (STICKER COLOUR)

Quarterly · yellow sticker

AREAS OF THIS EXHAUST SYSTEM WERE

☒ Inspected ☒ Cleaned

SECTION A

5. LAST SERVICE CLEANING DATE

Jul 7, 2026

5. LAST SERVICE COMPANY

Same company

SECTION A QUESTIONS

#	ITEM	FINDING	RESULT
01	1. Filters clean		Yes
02	2. Precipitators / pollution control devices clean		N/A
03	3a. Grease load under 2,000 µm (0.078 in.), horizontal duct		Yes
04	3b. Grease load under 2,000 µm (0.078 in.), vertical duct	Riser above the 3rd floor not reached; grease could not be measured.	No
05	3c. Grease load under 2,000 µm (0.078 in.), hood		Yes
06	4. Grease load in the fan under 3,175 µm (0.125 in.)		Yes
07	6a. On-site exhaust system diagram posted and accurate		Yes
08	6b. Entire system cleaned or inspected as the diagram shows	Riser above the 3rd floor not cleaned.	No

#	ITEM	FINDING	RESULT
09	7. Certificate of performance dated and placed near the hood		Yes
10	8a. All filters in place and intact		Yes
11	8b. Wash system: main water valve open		N/A
12	9. Fans operate		Yes
13	10. Exhaust fan louvers cleaned and checked		Yes
14	11. Exhaust fans cleaned		Yes
15	12. Fan belts and pulleys inspected and in good order		Yes
16	13. Grease cups cleaned		Yes
17	14. System appears liquid-tight		Yes
18	15. Horizontal duct cleaned or inspected		Yes
19	16. Vertical duct cleaned or inspected	Cleaned to the 3rd floor only.	No
20	17. Sufficient access panels	No access panel on the riser between the 3rd and 5th floors.	No
21	18. Access panels properly signed		Yes
22	19. All areas of the exhaust system accessible	Riser above the 3rd floor inaccessible.	No
23	20. Hood and exhaust system free of obstructions		Yes
24	21. Cleaning complied with NFPA 96		Yes

22. TYPE OF COOKING

☐ Solid fuel
 ☒ Wok
 ☒ Charbroil
 ☐ Other

DEFICIENCY REPORT

DEFICIENCIES

SECTION	ITEM #	DESCRIPTION OF DEFICIENCY
A	17	No access panel on the vertical riser between the 3rd and 5th floors.
A	16 / 19	Vertical duct above the 3rd floor could not be reached or cleaned.

COPY TO THE BOSTON FIRE DEPARTMENT

Deficiencies were found. A completed copy of this report goes to the Boston Fire Department, Fire Prevention Division, within 5 business days, as the BFD sample report instructs.

AREAS NOT CLEANED AND WHY

Vertical riser above the 3rd floor: no access panel.


☒ Certification of performance sticker placed near the hood

NEXT CLEANING DUE
Jan 5, 2027

ADDITIONAL COMMENTS

Owner advised to have an access panel installed on the riser before the next cleaning.

PHOTOS

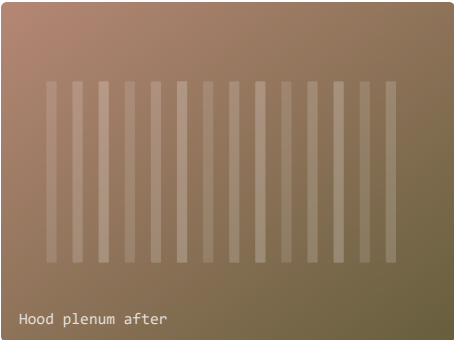


Hood plenum after

08:52



Riser, no access panel

09:21

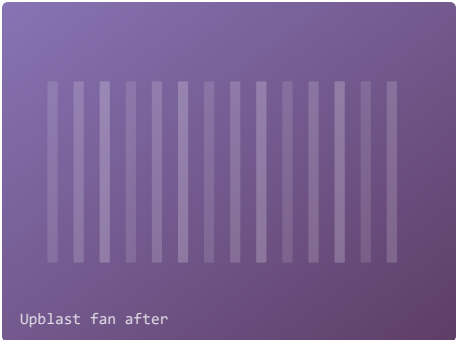

Upblast fan after

09:40

KEEP ON THE PREMISES

Keep this report on the premises. Boston Fire Department members and City of Boston health or building inspectors may ask to see it.

TECHNICIAN



Pat Doe · 10:22 AM
BFD Reg. BFD-2026-0417 · IKECA CECS



OWNER REPRESENTATIVE



Sam Example · 10:24 AM